


## General description

**Self-adhesive hangers** are designed to fix efficiently insulation on smooth surfaces such as air ducts.

It consists of a pin, firmly crimped on a high quality self-adhesive base.

Locking washers supplied in each box.

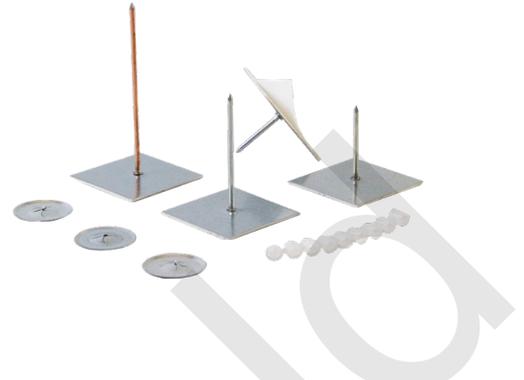


## Technical specification

		SC	SAP	SC-BGS	SC-SS
Base	Material	Galvanized steel			Stainless steel 304 (316 on request)
	Dimensions	50 x 50 mm (2" x 2")			
	Thickness	0,4 mm (28 ga.)			
Shank	Material	Up to 63 mm length (2-1/2") galvanized steel	Aluminium	Stainless steel 304 (Stainless steel 316 on request)	
		From 76 mm length (3") copper plated steel			
	Diameter	2,7 mm (12 ga.)			
Lengths	19 to 400 mm (3/4" to 16")	45 to 165 mm (1-3/4" to 6-1/2")	25 to 400 mm (1" to 16")		
Adhesive	Base	White, cross-linked, closed-cell polyethylene foam			
	Coating	Modified acrylate adhesive on both sides			
	Liner	Siliconized paper			
	Thickness	1 mm (1/25")			

## Locking washers

	SC		SAP	SC-BGS & SC-SS	
	CL-2-30	CL-2-40	CL-24-32	CL-2-30-SS	CL-2-40-SS
Material	Galvanized spring steel		Galvanized spring steel	Stainless steel 304 spring type	
Diameter	30 mm (1-3/16") supplied as standard	38 mm (1-1/2") supplied on request	32 x 30 mm (1-1/4 x 1-3/16")	30 mm (1-3/16") supplied as standard	38 mm (1-1/2") sup- plied on request
Thickness	0,35 mm (29 ga.)		0,4 mm (28 ga.)	0,33 mm (29 ga.)	
Edges	Beveled				

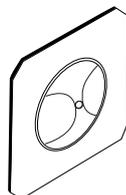

## Storage

2 years when stored in a dry place. +10°C to +30°C (+50°F to +90°F), with 50% relative humidity.


## Application recommendations

<b>Quantity</b>	8 to 12 hangers per square meter (1,20 sq Yd) are required in standard condition.
<b>Application</b>	* Surfaces should be clean and dry, free of dust, grease, oil and any other loose matter. * Avoid to use degreasing - products * Not for use in application likely to make contact with chlorinated, cetonic or esther solvents
<b>Application temperature</b>	+15 °C to +25 °C (+60°F to +77°F)
<b>Holding temperature</b>	-40 °C to +80 °C (-40°F to +176°F)

## Application




Apply at temperature range +15°C to +25°C (+60°F to +77°F). Surfaces should be clean and dry, free of dust, grease, oil and any other loose matter. Do not use degreasing products. Not for use in application likely to make contact with chlorinated, cetonic or esther solvents.

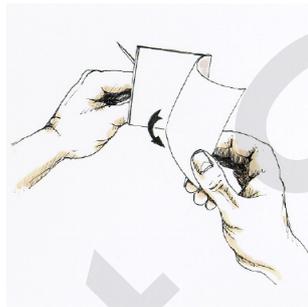


Remove the protective release paper taking care not to touch the adhesive



Place the hanger in the required position and press the base against the surface to be insulated

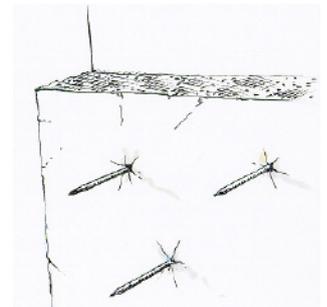

Insulation can be impaled immediately but maximum strength of adherence is achieved after 24 hours.

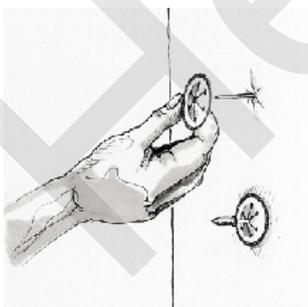

If necessary, cover the pin with protective cap.